


HOLDEN COMMODORE VE SERIES I 6L V8 AIR CONDITIONER BELT KEEPS COMING OFF



DAYCO®

HOLDEN COMMODORE VE SERIES I 6L V8


When under load the A/C will throw off and
in some cases destroy the belt

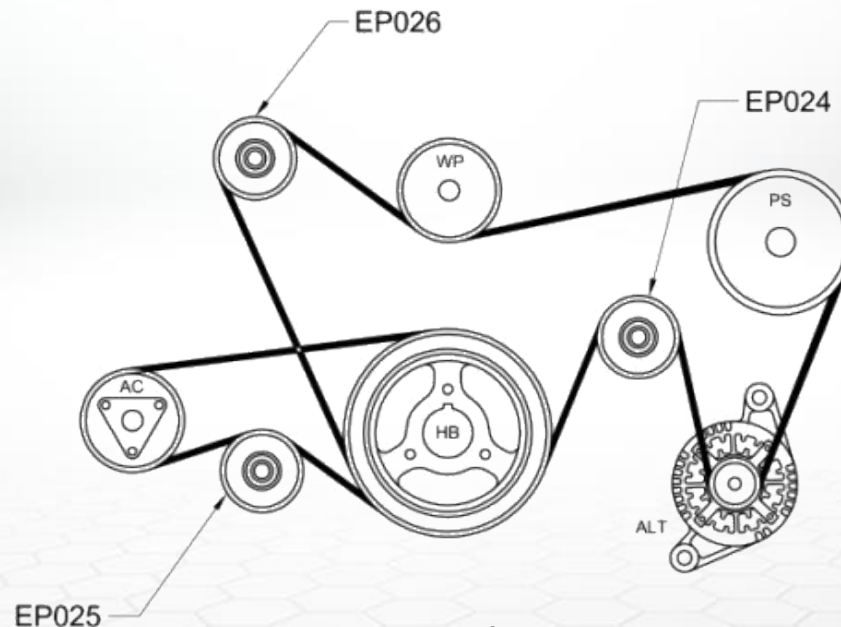

VE Commodore Series 1
(Tensioner only on A/C)

HOLDEN COMMODORE VE SERIES 1 6L V8

Series II Provided a fix with an idler pulley added to the A/C drive

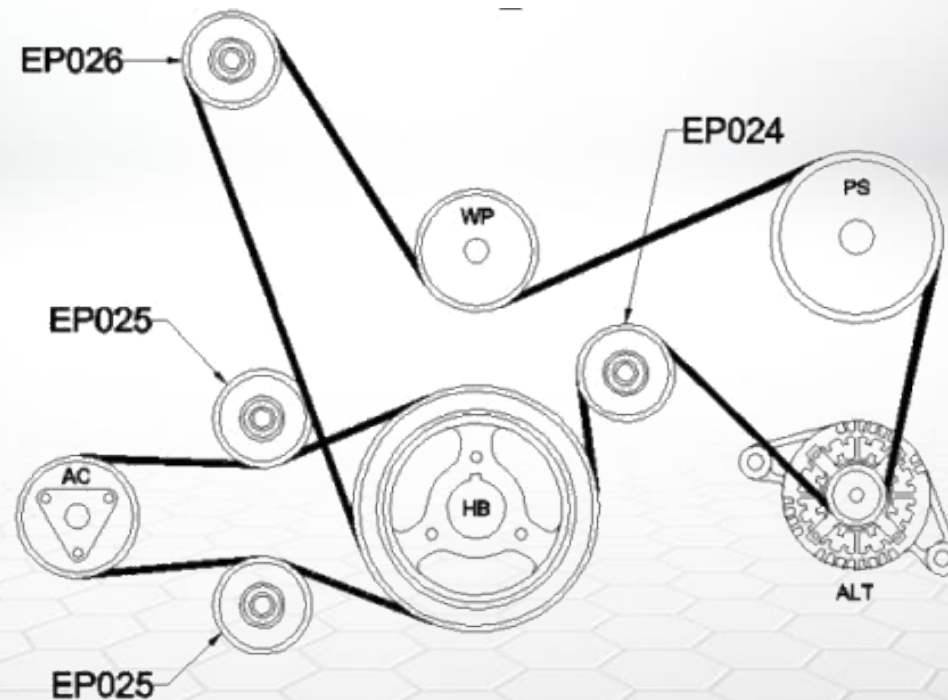

HOLDEN COMMODORE VE SERIES 1 6L V8

Replace the entire A/C bracket

- Holden A/C Bracket assembly comes with idler and tensioner Part No. 92252927
- Belt length will also change, replace the belt with a Dayco 4PK1115

